

Service Bulletin

File in Section:

Bulletin No.: 18-NA-346

Date: November, 2018

TECHNICAL

Subject: Vehicle Will Not Start and/or Service Electronic Steering Column Lock System Message Displayed on Driver Information Center (DIC)


This Bulletin replaces PIC5367A. Please discard PIC5367A.

Brand:	Model:	Model Year:		Breakpoint:		Engino	Transmission:
		from	to	from	to	Engine:	Transmission.
Chevrolet	Corvette	2005	2005				Equipped with 6 Speed Manual Transmission (RPO MM6)

Involved Region or Country	North America and N.A. Export Regions		
Condition	Some customers may comment on the vehicle not starting and/or a Service Electronic Steering Column Lock System message being displayed on the Driver Information Center (DIC). Note: The steering wheel may not turn when this condition occurs.		
Cause	This condition may be caused by the electronic steering column module failing to send the correct signal to the BCM.		
Correction	5161788		
	5161/85		

Copyright 2018 General Motors LLC. All Rights Reserved.


Page 2 November, 2018 Bulletin No.: 18-NA-346

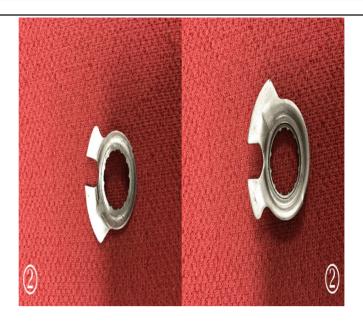


5161786

5163620

Replace the steering column lock plate (1) with the new plate (2), and update the BCM with the new utility file.

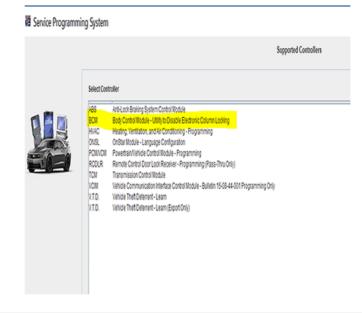

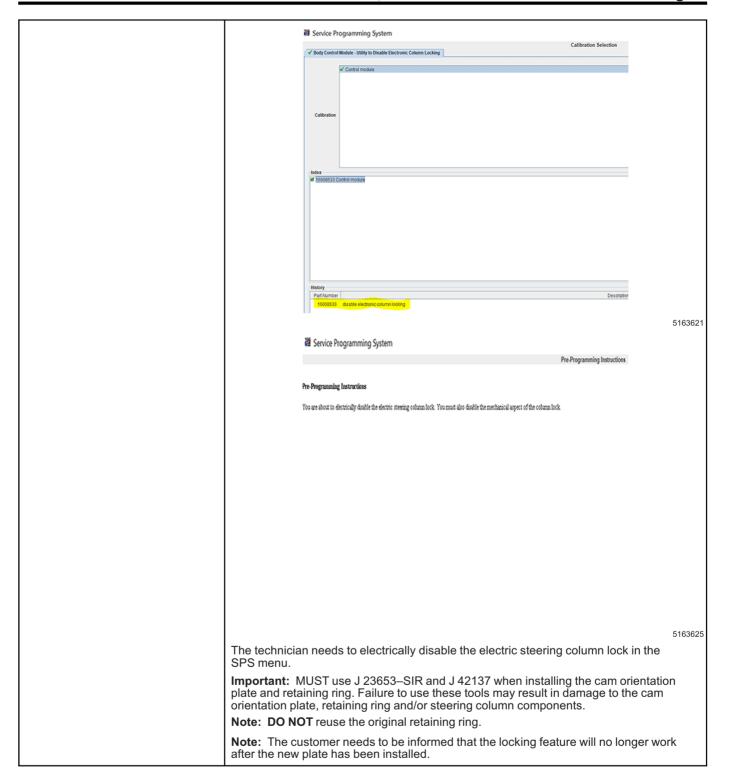

Parts Information

Causal Part	Description	Part Number	Qty
X	PLATE, T/SIG SW CANC CAM POSN (W/ SHIELD)	26049186	1
	RING, STRG SHF LK PLT RET	05694191	1

Warranty Information

Dealership personnel will need to inform the customer that this repair is **NOT** covered under warranty.

Version	1
Modified	Released November 14, 2018