## **Customer Satisfaction Program**

## 17245 Mechanical Trunk Release May Not Operate



Reference Number: N172093460 Release Date: June 2017

Revision: 00

Attention: This program is in effect until July 31, 2019.

		Model Year		Model Year			
Make	Model	From	То	RPO	Description		
Chevrolet	Corvette Convertible	2016	2017				

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Certain 2016-2017 model year Chevrolet Corvette Convertible vehicles may have a condition in which a
	"Trunk Ajar" message is displayed, or the mechanical trunk release may not operate to open the trunk
	lid.
Correction	Reprogram the liftgate control module.

#### **Parts**

No parts are required for this procedure.

#### **Warranty Information**

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9102918	Accessory and Liftgate Control Module Reprogramming with SPS	0.3*	ZFAT	N/A
9103237	Module Programming Not Required	0.2**	ZFAT	N/A

<sup>\*</sup> To avoid warranty transaction rejections, the SPS Warranty Claim Code must be entered when submitting this transaction.

### **Service Procedure**

Note: Carefully read and follow the instructions below.

- DO NOT attempt to order the calibration number from GM Customer Care and Aftersales. The calibration numbers required for this service procedure are programmed into control modules via a Multiple Diagnostic Interface (MDI) with the calibration update. If you cannot access the calibration, call the Techline Customer Support Center and it will be provided.
- DO NOT program a control module unless directed to by a service procedure or a service bulletin. If the control
  module is not properly configured with the correct calibration software, the control module will not control all of
  the vehicle features properly.
- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will
  interrupt programming. When required install the *EL-49642* SPS Programming Support Tool to maintain system
  voltage. If not available, connect a fully charged 12 V jumper or booster pack disconnected from the AC voltage
  supply. DO NOT connect a battery charger.
- Turn OFF or disable systems that may put a load on the vehicles battery such as; interior lights, exterior lights (including daytime running lights), HVAC, radio, etc.
- During the programming procedure, follow the SPS prompts for the correct ignition switch position.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.
- Refer to Liftgate Control Module Programming and Setup for additional information on programming.

<sup>\*\*</sup> SPS Warranty Claim Code is NOT required when submitting this transaction.

## **Customer Satisfaction Program**

## 17245 Mechanical Trunk Release May Not Operate



**Caution:** If the Same Calibration/Software Warning is noted on the SPS Controller screen, do NOT attempt to program the module. No further action is required. Refer to the Warranty section of the bulletin and use labor operation code 9103237, Module Programming Not Required.

- 1. Reprogram the liftgate control module. Refer to Liftgate Control Module Programming and Setup in SI.
- 2. Record SPS Warranty Claim Code on job card for warranty transaction submission.

### **Dealer Responsibility**

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this program <u>must</u> be held and inspected/repaired per the service procedure of this bulletin <u>before</u> customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

Dealers are to service all vehicles subject to this program at no charge to customers, regardless of mileage, age of vehicle, or ownership, through July 31, 2019. Customers who have recently purchased vehicles sold from your vehicle inventory, and for which there is no customer information indicated on the involved vehicle listing, are to be contacted by the dealer. Arrangements are to be made to make the required correction according to the instructions contained in this bulletin. A copy of the customer letter is provided in this bulletin for your use in contacting customers. Program follow-up cards should not be used for this purpose, since the customer may not as yet have received the notification letter.

In summary, whenever a vehicle subject to this program enters your vehicle inventory, or is in your facility for service through July 31, 2019, you must take the steps necessary to be sure the program correction has been made before selling or releasing the vehicle.

### **Dealer Reports**

For dealers with involved vehicles, a listing with involved vehicles has been prepared and will be provided to U.S. and Canadian dealers through the GM GlobalConnect Recall Reports, or sent directly to export dealers. The listing may contain customer names and addresses obtained from Motor Vehicle Registration Records. The use of such motor vehicle registration data for any purpose other than follow-up necessary to complete this program is a violation of law in several states/provinces/countries. Accordingly, you are urged to limit the use of this report to the follow-up necessary to complete this program.

 
#### Courtesy Transportation - For USA & Canada

Courtesy transportation is available for customers whose vehicles are involved in a product program and still within the warranty coverage period. See General Motors Service Policies and Procedures Manual, Sections 1.4 and 6.1.10, for courtesy transportation program details.

#### **Customer Notification**

USA & Canada - General Motors will notify customers of this program on their vehicle (see copy of customer letter included with this bulletin).

Export - Letters will be sent to known owners of record located within areas covered by the US National Traffic and Motor Vehicle Safety Act. For owners outside these areas, dealers should notify customers using the attached sample letter.



## **Customer Satisfaction Program**

This notice

# 17245 Mechanical Trunk Release May Not Operate



	July 2017
applies to your vehicle, VIN:	

Dear General Motors Customer:

We have learned that your 2016-2017 model year Chevrolet Corvette may have a condition in which a "Trunk Ajar" message is displayed, or the mechanical trunk release may not operate to open the trunk lid.

Your satisfaction with your Corvette is very important to us, so we are announcing a program to prevent this condition or, if it has occurred, to fix it.

What We Will Do: Your GM dealer will reprogram the liftgate control module. This service will be performed for you at no charge until July 31, 2019. After that, any applicable warranty will apply.

What You Should Do: To limit any possible inconvenience, we recommend that you contact your dealer as soon as possible to schedule an appointment for this repair.

If you have any questions or concerns that your dealer is unable to resolve, please contact the appropriate Customer Assistance Center at the number listed below.

Division	Number	Text Telephones (TTY)	
Chevrolet	1-800-222-1020	1-800-833-2438	
Puerto Rico – English	1-800-496-9992		
Puerto Rico – Español	1-800-496-9993		
Virgin Islands	1-800-496-9994		

We sincerely regret any inconvenience or concern that this situation may cause you. We want you to know that we will do our best, throughout your ownership experience, to ensure that your Chevrolet Corvette provides you many miles of enjoyable driving.

Terry M. Inch
Executive Director
Global Connected Customer Experience

17245