

*SBC - 1955-57 models have an oiling groove in the rear journal. The listed part numbered cams will not fit these models, so if you require a camshaft with the oiling groove, please call us at 1-800-999-0853 or [click here to contact us](#), and we will assist you with placing an order.

Description



[Return to Store Item](#)

Part Number: Grind Number:

Lifter Type:

Engine Family:




Description:

Cam Family:

Specifications

		Intake	Exhaust
RPM Range:	<input type="text" value="1800 to 5800"/>	<input type="text" value="Hyd."/>	<input type="text" value="Hyd."/>
Valve Timing:	<input type="text" value="0.001"/>	<input type="text" value="342"/>	<input type="text" value="342"/>
Lobe Separation:	<input type="text" value="114°"/>	<input type="text" value="222"/>	<input type="text" value="222"/>
Intake Centerline:	<input type="text" value="114°"/>	<input type="text" value="0.447"/>	<input type="text" value="0.447"/>
		<input type="text" value="0.298"/>	<input type="text" value="0.298"/>

Valve Timing @ 0.001 Lift:

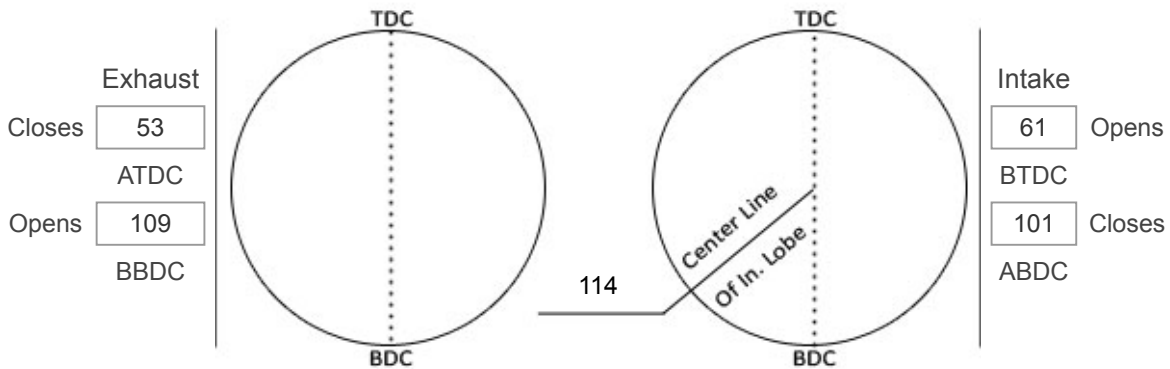

Recommended Components

Component	Part Number
Lifter Kit	812-16 / 858-16
Timing Set	2100 / 3100
Rocker Arms	1412-16 [15,52] / 1601-16 [15,52]
Push Rods	7812-16 / 7372-16
Valve Springs	981-16 / 26981-16 [2]
Steel Retainers	750-16 / 795-16 [3]
Valve Locks	613-16 / 611-16

Valve Seals [501-16](#)

Camshaft Break-In Lube [159](#)

Installation Notes (These notes apply to the above recommended components with the trailing installation note numbers)

Note	Description
2	[2] Requires machining on cylinder heads.
3	[3] Standard weight and lightweight retainers
15	[15] 50-State legal on '93 & earlier S.B. Chevrolet V8, 262-400 c.i., C.A.R.B. E.O. #D-279-4.
52	[52] Engines with self-aligning rocker arms must use part #1417-16 or 1317-16.

[Contact us via email](#)



[ADD TO BASKET](#)

[Return to Store Item](#)